Tensor



ACOUSTIC PANEL CONTACT ADHESIVE


TensorGrip® X30 has been endorsed by and developed in conjunction with Autex for all Acoustic lining bonding applications. TensorGrip® X30 provides very fast tack times and utilises high solids semi-pressure sensitive contact adhesive technology, this product is highly suited for all types of acoustic panel installation, including in-house and onsite bonding processes. $\textbf{TensorGrip}^{\$}$ X30 is designed to give a long open time and high tack level with excellent bond.

QUIN GLOBAL UK Ltd.

ADVANTAGES

- High Strength.
- Low Odour.
- High Temperature Resistance.
- Long Open Time.

SQUARE METRE COVERAGE (m²):

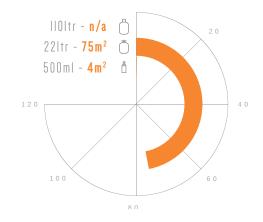

APPLICATION:

FLASH-OFF*:



2 sided



1-2 mins

OPEN TIME*:





Up to 30 mins





Clear (500ml only)



Green (22ltr only)

PROPERTIES:

SUITABLE FOR:



Thick Fabric



Web Spray



Fabric



Carpet



Foam

*depending on ambient temperature















Technical Data Sheet V1.0 - 05.2021 © Ouin Global UK Ltd. 2021 www.tensorglobal.com

CHEMICAL TECHNICAL DATA

Viscosity	350 cps 25°C sp#2, 30r.p.m.
Total Solids	28%-30%
Colour	Clear (500ml only) Green (22ltr only)
System Flammability	Non-flammable adhesive solution in flammable propellant
Shear	> 250 p.s.i.
Tensile (180° Peel)	> 25 p.s.i.
90° Peel (6.25 sq.cm)	> 25 p.s.i.
Shear adhesion failure temp. (SAFT) 100gram	> 124°C
Heat resistance (25mm/100gram)	115°C
Dry time	1-2 mins dependant on temp & humidity
Open time	30 mins
SHELF LIFE	18 months from date of manufacture

CANISTER STORAGE/CHANGE OVER

Turn valve on canister into the off position, spray out remaining adhesive left in the hose, disconnect the spray hose and gun from the canister. Reconnect the spray hose to a canister of cleaning solvent (sold separately) and spray out until liquid is clear which indicates that the hose and gun is clean. If you choose to leave the hose and spray gun on the canister, leave the valve on the canister open. Do not disconnect the hose/gun from the canister. Close and lock the spray gun.

HANDLING & STORAGE

- Consult Material Safety Data Sheet prior to use.
- DO NOT store at temperatures over 50°C.
- Avoid exposure to direct sunlight.
- DO NOT store directly on concrete floor.
- For optimum performance, store at 18°C during use, but must always be above 10°C.
- When connected, keep valve open and hose pressurised at all
- DO NOT close valve until ready to connect to new cylinder.
- Release pressure in hose before disconnection.
- Always test product to determine suitability for your particular application prior to use in production.

DIRECTIONS FOR USE

- This product is designed to be applied to two surfaces to be bonded together. For best results, the temperature of the adhesive and the surfaces being bonded should be between 60 °F - 80 °F (16 °C - 27 °C).
- Use with adequate ventilation. When possible we recommend shaking the canister well before using.
- Attach and secure hose tightly onto the spray gun with required tip. Attach the other end of the hose onto the canister. Make sure the hose-valve connections are securely tight. Open the valve on the canister slowly and fully, check for leaks during this process. Unlock the trigger on the spray gun to start spraying.
- Prior to use, check compatibility by spraying a small test patch of the adhesive on the substrate. This product may degrade some substrates.



Make sure that surfaces are clean, dry and free from dirt, dust, oil, loose paint, wax or grease, etc.



- Spray about 10-20 cm (4" 8") away at a 90° angle to the surface, applying a uniform, even coat of adhesive to obtain 80% to 100% coverage of the surface. If necessary, spray another coat of adhesive in areas that appear to need more adhesive.



Spray both surfaces to be bonded, one surface vertically and the other surface horizontally.



Allow the adhesive to tack off until no adhesive transfers to the knuckle when touched.



- Adhere surfaces and press together with adequate pressure. A roller is recommended to apply a uniform pressure to achieve maximum strength. Allow 24 hours for the adhesive to fully cure.
- If the spray tip clogs, unscrew the spray tip from the gun and clean with solvent such as lacquer thinner or acetone. Do not use a pin on the spray tip.

COVERAGE







COVERAGE TOO HEAVY



CORRECT APPLICATION = 20 dry gms/sqm













